AH201 HALL-EFFECT SWITCH INTEGRATED CIRCUITS

These Hall-effect switch integrated circuits are monolithic integrated circuit consisting of a voltage regulator, Hall-voltage generator, differential amplifier, schmitt trigger, temperature compensation circuit and open-collector output stage. Its input is a magnetic flux density signal and output is a digital voltage signal.

FEATURES

. Wide supply voltage range
. Fast response time
. Wide frequency and temperature range
. Long operating life
. Small size, convenient installing
. Output compatible with all digital logic families

TYPICAL APPLICATIONS

. Contactless switch
. Position control
. Speed measurement
. Revolution detection
. Isolation measurement
. Brushless d.c motor
. Automotive ignitor

ABSOLUTE MAXIMUM RATING

Parameter	Symbol	Value	Unit
Supply voltage	V_{CC}	24	V
Magnetic flux density	B	Unlimited	mT
Output OFF voltage	V_{ce}	50	V
Continuous output current	I_{OL}	50	mA
Operating temperature range	T_A	-25~85	℃
Storage temperature range	T_S	-55~150	℃

ELECTRICAL CHARACTERISTICS

T_A=25℃

Parameter	Symbol	Test condition	Type and Value			Unit
			min	typ	max	
Supply voltage	V_{CC}		4.5	-	24	V
Output saturation voltage	V_{OL}	Iout=20mA B>B_{OP}	-	200	400	mV
Output leakage current	I_{OH}	Vout=24V B<B_{RP}	-	0.1	10	μA
Supply current	I_{CC}	V_{CC}=Output open	-	-	10	mA
Output rise time	t_r	R_L=820Ω C_L=20PF	-	0.12	-	μS
Output fall time	t_f	R_L=820Ω C_L=20PF	-	0.18	-	μS

MAGNET CHARACTERISTICS

V_{CC}=4.5～24V

Parameter	Symbol	Type and Value			Unit
		min	typ	max	
Operate point	B_{OP}			11	mT
Release point	B_{RP}	2			mT
Hysteresis	B_H		5	-	mT

NOTE: 1mT=10GS

BLOCK DIAGRAM

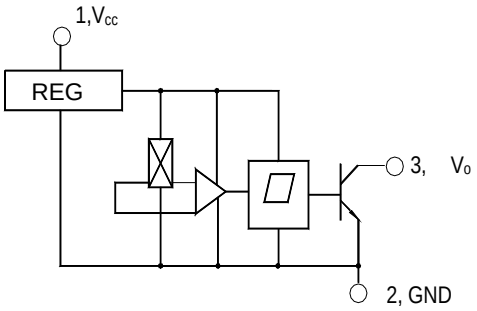

MAGNETIC-ELECTRICAL TRANSFER CHARACTERISTICS

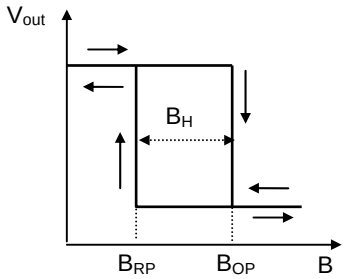

DIMENSIONS (in: mm)

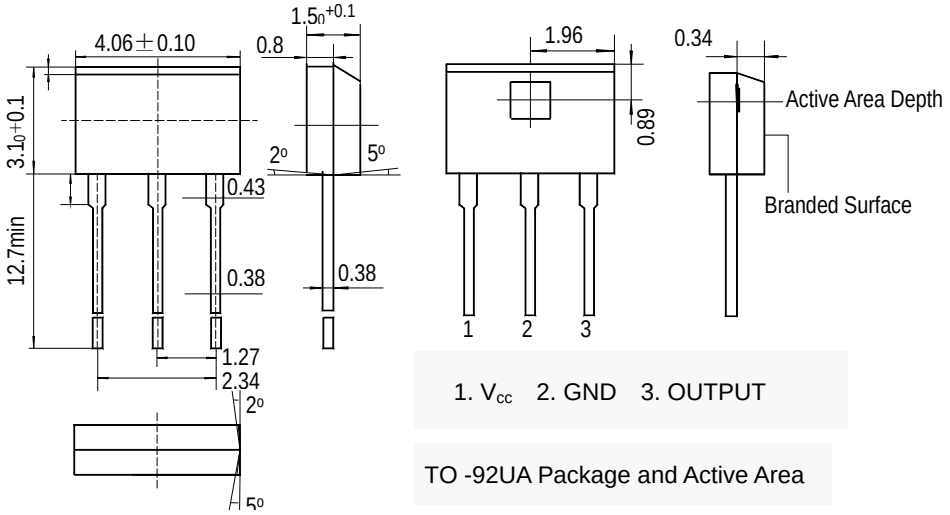

1. V_{cc} 2. GND 3. OUTPUT

TO -92UA Package and Active Area

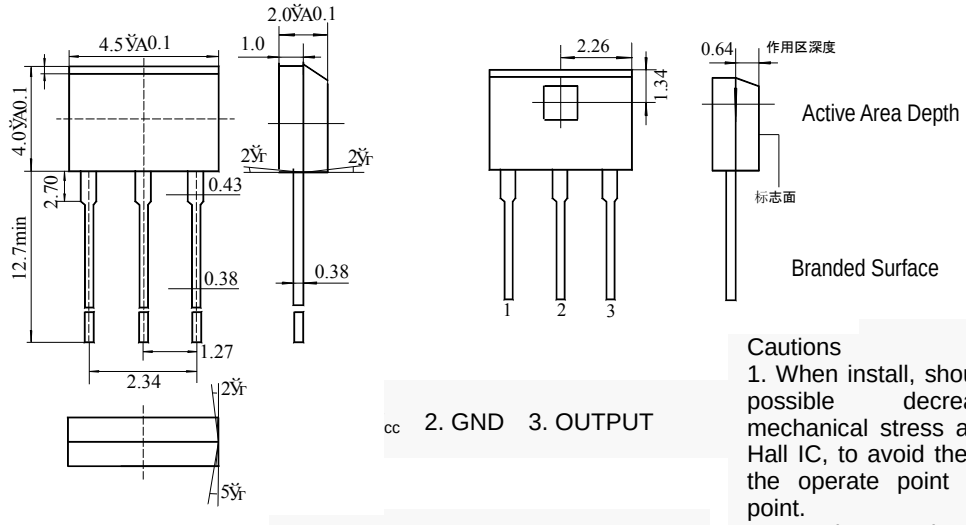

cc 2. GND 3. OUTPUT

TO –92T Package and Active Area

Cautions
1. When install, should as full as possible decrease the mechanical stress acting on the Hall IC, to avoid the influence of the operate point and release point.
2. On the premise of ensuring welding quality, use as possible as low welding temperature as short time.